

Product Group: GENERATORS

Model: DCA70SSIU4F, DCA125SSIU4F.

DCA400SSI4F3

ISUZU NOX SENSOR FAULT DIAGNOSIS AND REPLACEMENT

This document provides diagnostic guidance and replacement procedures for Isuzu NOx sensors. It outlines how to interpret Diagnostic Trouble Codes (DTCs), determine whether a sensor requires replacement or cleaning, and complete the post-repair procedure.

Note: The expected service life of the NOx sensor is 8,000 hours under normal operating conditions. When having a single NOx sensor failure with higher hours, its recommended to replace both sensors at the same time.

DTC Diagnosis:

Before replacing a NOx sensor, verify the active DTC using IDST or IDSS engine diagnostic software.

Fault verification via SPN/FMI can also be found within the machine controller under DM1 (Active DTC's) and DM2 (History/Stored DTC's).

- SPN 10504 FMI 12 Inlet (Ft) NOx Sensor Open or Shorted
- SPN 10540 FMI 12 Outlet (Rr) NOx Sensor Open or Shorted

It is recommended to determine component failure and or issues via the engine interface tool.

Fault Code Interpretation:

DTC – P2210: Reading the error(open) information detected by Rr NOx sensor DTC – P2206: Reading the error(open) information detected by Ft NOx sensor

- Indicates a sensor failure.
- · Requires replacement of the NOx sensor.

DTC – P2211: Reading the error(short) information detected by Rr NOx sensor DTC – P2207: Reading the error(short) information detected by Ft NOx sensor

• Indicates the sensor is unable to detect NOx, often due to contamination or excessive DEF buildup.

Action:

- · Remove the affected sensor.
- Carefully clean DEF or soot buildup from the probe area using a soft wire brush. Avoid using harsh chemicals or abrasive materials that could damage the sensor.
- Do not allow the sensor tip to become wet.
- Reinstallation of the same sensor is acceptable.
- Note: A SHORT DTC does not require replacement.







Excessive DEF Buildup on NOx Sensor

Clean NOx Sensor

The information and specifications included in this publication were in effect at the time of approval for printing. Illustrations, descriptions, references and technical data contained in this document are for guidance only and may not be considered as binding. Multiquip Inc. reserves the right to discontinue or change specifications, design or the information published in this publication at any time without notice and without incurring any obligations.



Product Group: GENERATORS Model: DCA70SSIU4F, DCA125SSIU4F. DCA400SSI4F3


ISUZU NOX SENSOR FAULT DIAGNOSIS AND REPLACEMENT

Post-Replacement / Cleaning Procedure:

Note: Use a special high-temperature, sensor-safe anti-seize compound on the threads of an Isuzu NOx sensor during installation.

After replacing or cleaning NOx sensors:

- Reinstall sensor(s) within SCR
- Using 7/8" Hex Wrench Tightening Torque: 7.4 (ft-lb) or 88.5 (in-lb)
- Clear active DTC's
- Perform 8 forced purges (regenerations) to ensure removal of excessive DEF from the SCR system

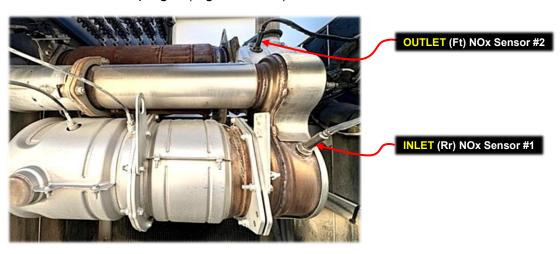


Installation Guidelines:


Proper installation is critical for accurate PPM measurement in exhaust flow.


- Sensor #1 Inlet NOx Sensor (5-wire configuration)
- Sensor #2 Outlet NOx Sensor (4-wire configuration)

(Inlet Sensor #1)

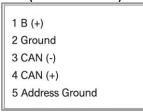

(Outlet Sensor #2)

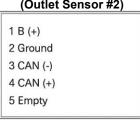

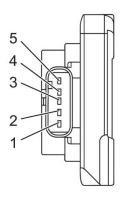

^{*} Correct wiring orientation will ensure accurate data transmission and system performance.

The information and specifications included in this publication were in effect at the time of approval for printing, Illustrations, descriptions, references and technical data contained in this document are for guidance only and may not be considered as binding. Multiquip Inc. reserves the right to discontinue or change specifications, design or the information published in this publication at any time without notice and without incurring any obligations.