



This bulletin is provided for technical reference and service related updates. If you have any questions, comments or do not wish to receive these e-mails, please reply to this e-mail or call the Service Technical Support Group 800 478-1244.

FUEL HOSE INSPECTION

There have been reports from the field that some LT12D light towers with Kohler KDW1003 engine supplied fuel hoses, have been splitting. See photos below of fuel hoses.

NOTE: Warranty can be submitted through Kohler Engine dealer network.

Kohler production change took effect on 6/28/2012 starting with serial # 9158364

INSPECTION

- If any hose is found defect, replace BOTH supply and return lines from the engines fuel rail.
- Carefully inspect and feel the line. Look for hose bulging and splitting.
- Primary Inspection Location: Check the hoses at the point they connect to the fuel rail.
- Secondary Inspection: Check the entire length of both fuel lines down to the filter assembly

| MQ PART # | DESCRIPTION | QTY |
|-----------|-------------------------|-----|
| 9375857 | Fuel hose / supply line | 1 |
| 3630050 | Clamp | 1 |
| 9376117 | Fuel hose / return line | 1 |
| 3630217 | Clamp | 1 |
| 4670059 | Gasket | 4 |

