



Service Bulletin

MTX60 Fuel Cap Inspection

Product Group: Rammers	Date Issued: 04/01/11	Service Bulletin No. RT20110401
Bulletin Type <input checked="" type="checkbox"/> Mandatory <input type="checkbox"/> Information Only <input type="checkbox"/> Recommended Change		Models/Series Affected: S/N V-6045 – V-6088, V-6093 – V-6098, V-6105 – V-6112, V-6129 – V-6132, V-6173 – V-6331

Details Problem <p>Some Multiquip MTX60 rammers within the serial number range listed above may have been shipped with incorrect fuel caps.</p> <p>Correct fuel caps will have a “duck-bill” vent on the inside of the cap designed to allow proper tank ventilation for machines equipped with diaphragm carburetors. Rammers that do not have this type of cap may experience fuel leakage when the rammer is laid down during transport.</p> Solution: <p>Follow the attached inspection procedure to identify whether the rammer is properly equipped from the factory.</p> <p>If the rammer does not have the “duck-bill” vent, contact the Multiquip parts department to order the replacement cap.</p>
--

Parts Information		
<u>Description</u>	<u>Part Number</u>	<u>Qty.</u>
Cap Assy, Fuel Tank	366900020	1



MTX60

Fuel Cap Inspection

The following instructions are intended to assist the user in the inspection of the fuel cap on the MTX60 rammers affected by Service Bulletin RT20110401. Please read all inspection instructions.

INSPECTION PROCEDURE

Follow these steps to identify whether the rammer is properly equipped from the factory.

1. Remove the fuel cap from the fuel tank (Figure 1).

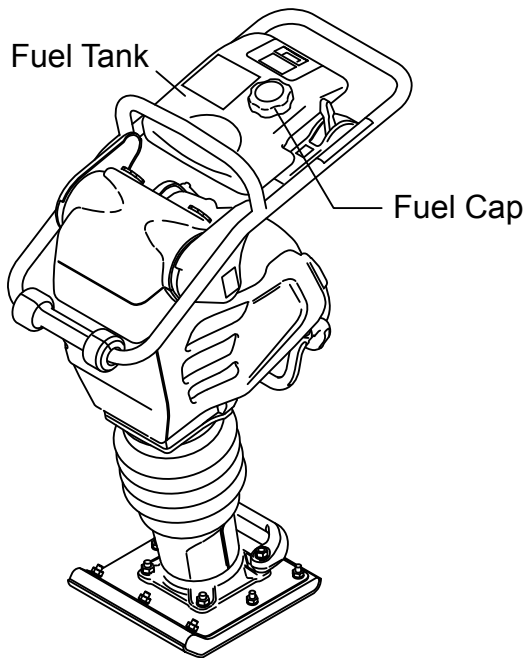


Figure 1. Remove Fuel Cap

2. Use a flat blade screwdriver to remove the plastic cover from the inside of the cap (Figure 2).

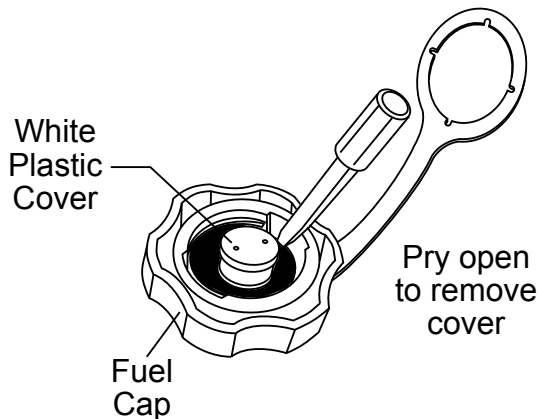


Figure 2. Remove Plastic Cover

3. If the inside of the cap has a rubber “duck-bill” vent (Figure 3), no further action is required.

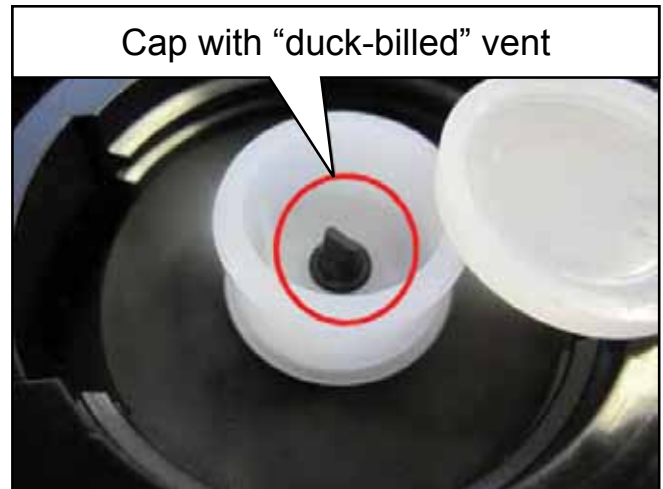


Figure 3. Cap with “Duck-Billed” Vent

4. If the inside of the cap **DOES NOT** have a rubber “duck-bill” vent (Figure 4), order the correct cap (P/N 366900020) from the Multiquip parts department.



Figure 4. Cap without “Duck-Billed” Vent



MTX60

Fuel Cap Inspection

HERE'S HOW TO GET HELP

PLEASE HAVE THE MODEL AND SERIAL
NUMBER ON-HAND WHEN CALLING

UNITED STATES

Multiquip Corporate Office

18910 Wilmington Ave. Tel. (800) 421-1244
Carson, CA 90746 Fax (800) 537-3927
Contact: mq@multiquip.com

Service Department

800-421-1244 Fax: 310-537-4259
310-537-3700

Technical Assistance

800-478-1244 Fax: 310-943-2238

MQ Parts Department

800-427-1244 Fax: 800-672-7877
310-537-3700 Fax: 310-637-3284

Warranty Department

800-421-1244 Fax: 310-943-2249
310-537-3700

MEXICO

MQ Cipsa

Carr. Fed. Mexico-Puebla KM 126.5 Tel: (52) 222-225-9900
Momoxpan, Cholula, Puebla 72760 Mexico Fax: (52) 222-285-0420
Contact: pmastretta@cipsa.com.mx

CANADA

Multiquip

4110 Industriel Boul. Tel: (450) 625-2244
Laval, Quebec, Canada H7L 6V3 Tel: (877) 963-4411
Contact: jmartin@multiquip.com Fax: (450) 625-8664

UNITED KINGDOM

Multiquip (UK) Limited Head Office

Unit 2, Northpoint Industrial Estate, Tel: 0161 339 2223
Globe Lane, Fax: 0161 339 3226
Dukinfield, Cheshire SK16 4UJ
Contact: sales@multiquip.co.uk

© COPYRIGHT 2011, MULTIQUIP INC.

Multiquip Inc and the MQ logo are registered trademarks of Multiquip Inc. and may not be used, reproduced, or altered without written permission. All other trademarks are the property of their respective owners and used with permission.

The information and specifications included in this publication were in effect at the time of approval for printing. Illustrations, descriptions, references and technical data contained in this document are for guidance only and may not be considered as binding. Multiquip Inc. reserves the right to discontinue or change specifications, design or the information published in this publication at any time without notice and without incurring any obligations.

Your Local Dealer is:

