



This bulletin is provided for technical reference and service related updates. If you have any questions, comments or do not wish to receive these e-mails, please reply to this e-mail or call the Service Technical Support Group 800 478-1244.

## RECEIVER & COCKPIT

In 2007 the receiver and cockpit programming was changed in the RAMMAX HHMR and FCR.


Both receiver and cockpit must have the same designation on the components or they will not properly communicate with each other.

If your machine is in need of a replacement receiver or cockpit, check the original components labels before ordering.

### WHAT TO LOOK FOR



REAR OF COCKPIT

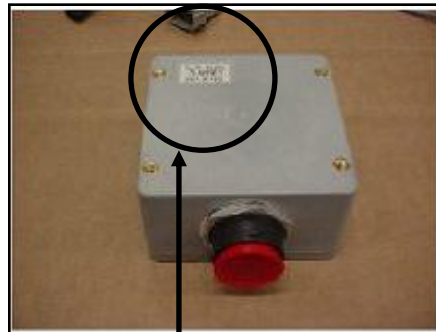

TOP OF RECEIVER



Notice the label on the back of each component. The receiver has **Rec 07** and the cockpit has **Cockpit 07**. This verifies the two will communicate with each other.

(See next page for ordering correctly)



# Technical Information

## ORDERING THE CORRECT REPLACEMENT PARTS

---

If your existing receiver and cockpit contain the **07** on the label then ordering an individual component is not a problem, these components will communicate.

**RECEIVER - MQ PART# 3-68561**

**COCKPIT - MQ PART# 3-68562**

If your existing receiver and cockpit **DO NOT** contain the **07** on the label, you will have to order both as a communicating set, which will include the **07** label.

**RECEIVER AND COCKPIT COMMUNICATING SET - MQ PART# 685961/2KIT**



*This cockpit does not have the Cockpit 07 on the label.*