


This bulletin is provided for technical reference and service related updates. If you have any questions, comments or do not wish to receive these e-mails, please reply to this e-mail or call the Service Technical Support Group 800 478-1244.


STARTER SWITCH CHANGE

The starter switch has been changed from a 5 terminal switch to a 6 terminal switch. The part number remains the same. The new switch has an extra terminal which is not used. It will require the technician to reconfigure the harness connector to match the new terminal positions. The extra terminal should be removed.

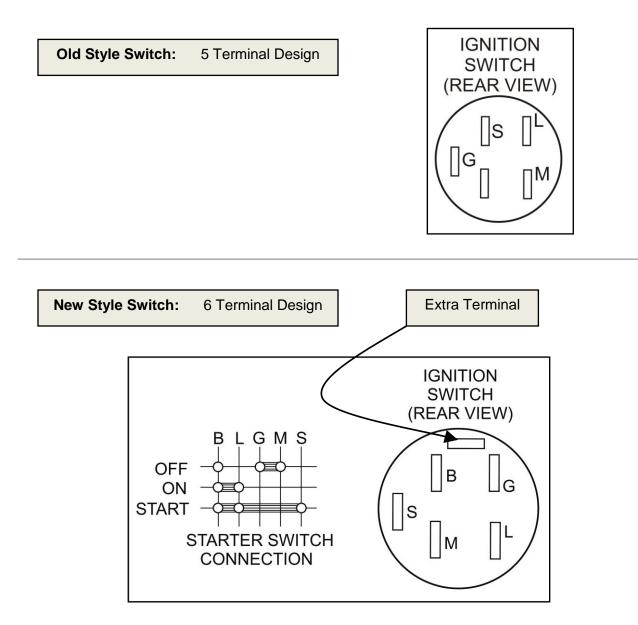

(see next page)



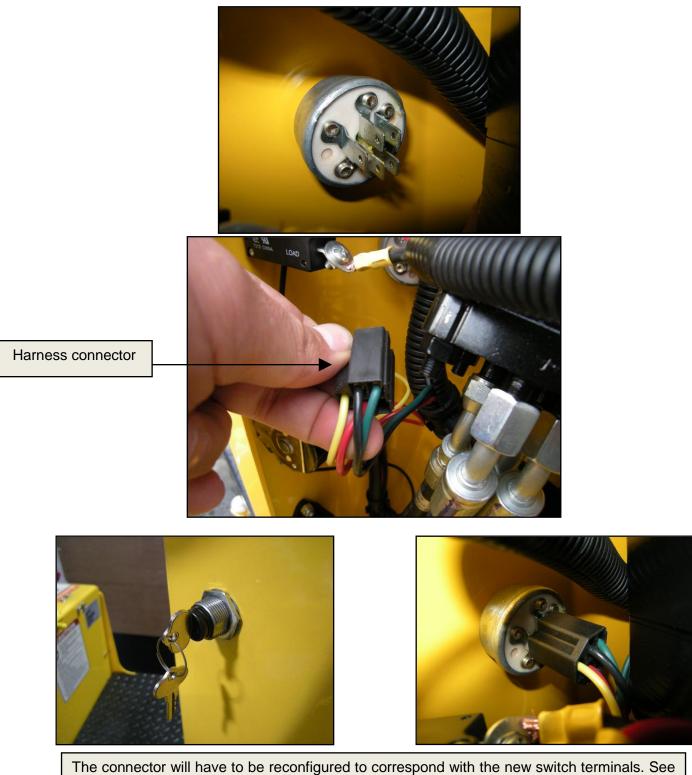

page one, terminal configuration is different between old switch and new switch.